



CAE Motorsport, LLC
 1521 Highland Road
 Twinsburg, OH 44087
 (216) 260-0742
 service@caemotorsport.com
 www.caemotorsport.net

Invoice #2677

Created: 11/18/2025 at 9:40AM
 Invoiced: 11/25/2025 at 11:05AM
 Payment Term: Net 10
 Payment Due: 12/05/2025
 Service Writer: Daniel Niedzwiecki

Switchcars Inc
 1521 Highland Road
 Twinsburg, OH 44087
 Office: (216) 453-0507
 info@switchcars.com

2011 BMW M3 Base (Black)
 VIN: WBSPM9C52BE203212
 Mileage In: 31,982 mi
 Mileage Out: 31,986 mi

Tire Replacement (Set of Four)				
Set of 4 Tires to be Mounted and Balanced.				
Description	Price	QTY	HRS	Subtotal
1 Tire Replacement			1.5	\$135.00
2 245/35-19 Mich Pilot Sport 4S	\$311.82	2		\$623.64
3 265/35-19 Mich Pilot Sport 4S	\$358.08	2		\$716.16
4 4 Wheel Touch Up	\$605.00			\$605.00
5 Alignment	\$141.63			\$141.63
6 Tire Disposal				\$35.00
			Shop Supplies (5%): \$6.75	Total: \$2,263.18

Install Stock Exhaust System				
Description	Price	QTY	HRS	Subtotal
1 R&R Headers, Mid Pipe and Muffler. R&R Sub Frame, R&R Front Cradle, R&R Heat Shields, R&R Steering Rack. Top Off Power Steering Fluid.			13	\$1,170.00
2 Exhaust Manifold Gaskets Cylinder 2,3,4,5	\$20.77	4		\$83.08
3 Exhaust Manifold Gaskets Cylinders 1,6,7,8	\$16.96	4		\$67.84
4 Exhaust hanger	\$16.92	2		\$33.84
5 Exhaust Manifold Bolt	\$18.25	4		\$73.00
6 Exhaust Nut	\$1.28	4		\$5.12
7 Exhaust Clamp	\$18.48	2		\$36.96
8 Power Steering Fluid CHF 11S	\$28.65	0.7		\$20.05
9 Shipping				\$14.98
			Shop Supplies (5%): \$18.25	Total: \$1,523.12

Update all Modules to the most recent version 14			
Description	Price	Subtotal	
1 Update all Modules to the most recent version 14	\$285.87	\$285.87	
		Total: \$285.87	



CAE Motorsport, LLC
 1521 Highland Road
 Twinsburg, OH 44087
 (216) 260-0742
 service@caemotorsport.com
 www.caemotorsport.net

Invoice #2677

Created: 11/18/2025 at 9:40AM
 Invoiced: 11/25/2025 at 11:05AM
 Payment Term: Net 10
 Payment Due: 12/05/2025
 Service Writer: Daniel Niedzwiecki

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about any work performed.

Totals only include authorized services

Signature _____

Labor	\$1,305.00
Parts	\$319.89
Tires	\$1,339.80
Subcontracts	\$1,032.50
Subtotal	\$3,997.19
Shop Supplies	\$25.00
EPA	\$0.00
Fees	\$49.98
Tax	\$0.00
Grand Total	\$4,072.17
Paid to Date	(\$4,072.17)
REMAINING BALANCE	\$0.00

Payments		
12/10/2025	Check #3155	\$4,072.17
Total Payments		\$4,072.17

Authorizations		
In Person by Switchcars Inc 11/26/2025 at 3:52 PM EST	+ Update all Modules to the most recent version 14 + Tire Replacement (Set of Four) + Install Stock Exhaust System	\$4,072.17 +\$427.50
In Person by Switchcars Inc 11/24/2025 at 11:35 AM EST	+ Tire Replacement (Set of Four) + Install Stock Exhaust System	\$3,644.67

Needs Response

Diag Brake Light on Cluster. Bad Rear Brake Pad Sensor				
Description	Price	QTY	HRS	Subtotal
1 Diag Brake Light on Cluster. R&R Rear Brake Pad Sensor			0.7	\$63.00
2 Rear Brake Pad Sensor	\$11.79	1		\$11.79
				Total: \$74.79



CAE Motorsport, LLC
 1521 Highland Road
 Twinsburg, OH 44087
 (216) 260-0742
 service@caemotorsport.com
 www.caemotorsport.net

Invoice #2614

Created: 10/15/2025 at 12:16PM
 Invoiced: 10/23/2025 at 3:04PM
 Payment Term: Net 10
 Payment Due: 11/02/2025
 Service Writer: Daniel Niedzwiecki

Switchcars Inc
 1521 Highland Road
 Twinsburg, OH 44087
 Office: (216) 453-0507
 info@switchcars.com

2011 BMW M3 Base (Black)
 VIN: WBSPM9C52BE203212
 Mileage In: 31,763 mi
 Mileage Out: 31,977 mi

Customer Comments	Recommendations
05/31/2025 30,864 oil changed	DME All Readiness monitors are incomplete. Vehicle either has tune or more miles need to be driven
09/03/2025 31,613 vehicle serviced	
	StopTech Brake System Front and Back
	Eventuri Intake
	TC Kline coil over suspension
	Fall-Line adjustable rear camber arms
	Solid Aluminum Rear Subframe Mounts
	Adjustable Front and Rear sway bars

Vehicle Inventory Inspection				
Description	Price	QTY	HRS	Subtotal
1 Vehicle Inventory Inspection			1.5	\$135.00
2 10W-60 Full Synthetic (1L) Liqui-Moly	\$11.00	0.5		\$5.50
3 Hood Struts	\$28.37	2		\$56.74
4 Oil Filter Mahle OX-254 D3 E90 M3, E92 M3	\$24.44	1		\$24.44
			Shop Supplies (5%): \$6.75	Total: \$228.43

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about any work performed.

Signature _____

Labor	\$135.00
Parts	\$86.68
Subtotal	\$221.68
Shop Supplies	\$6.75
EPA	\$0.00
Tax	\$0.00
Grand Total	\$228.43
Paid to Date	(\$228.43)
REMAINING BALANCE	\$0.00

Payments		
10/31/2025	Check #3103	\$228.43
Total Payments		\$228.43



INVOICE

53971

INVOICE

bmw + audi + mini independent specialists

Printed Date: 07/26/2024

Work Completed: 07/26/2024

2011 BMW - M3 - 4L, V8 (0CI) VIN(C)

Lic #: 631EB

Odometer In : 30451

Unit #: E90 - S65

VIN #: WBSPM9C52 BE203212

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Oil Service Parts: 2- E92 M3 Oil/Filter	1.00	115.80	115.80	Change Oil & Filter. (E90/92 M3) Changed engine oil and filter. Reset CBS counter. Set and stored tire psi.	49.83
Oil Filter Kit (E90/92 M3) 11 42 7 837 997	1.00	0.00	n/c	Customer Request - Please perform nut and bolt inspection.	179.00
10W-60 Full-Synthetic Oil LM2024 (5 Liter)	9.00	0.00	n/c	Completed nut and bolt of front and rear suspension. Found various hardware not fully torqued.	
Windshield Washer Fluid CH 2555 (BULK)	1.00	0.00	n/c	Minor weepage from RF rebound adjuster area, LF bump adjuster area.	
Shop Supplies			8.47	Noted play in rear sway bar link rod ends. RR outer axle boot torn open. BFF was due in '23.	
				Hazardous Waste Disposal	2.66

Org. Estimate 365.63 Revisions 0.00 Current Estimate 365.63

Labor:	228.83
Parts:	124.27
HazMat:	2.66
SubTotal:	355.76
Tax:	9.87
Total:	365.63
Bal Due:	\$365.63

[Payments -]

Vehicle Received: 7/26/2024

Customer Number : 12284

Limited Warranty-Non-transferable-OriginalPurchaser Only - Warranty on parts and labor is 2 years or 24,000 miles whichever comes first unless otherwise noted on invoice. Warranties do NOT cover friction surfaces, including but not limited to: brake pads, brake discs, clutch pressure plates, clutch discs & flywheels. Warranty work must be performed at Orr Autosport, LLC and cannot exceed the original cost of repair.

Signature _____ Date _____



INVOICE

46720

Org. Est. # 117193

bmw + audi + mini
independent specialists

Date: 04/29/2021

INVOICE

2011 BMW - M3 - 4L, V8 (0CI) VIN(C)

Lic # : 631EB

Odometer In : 29958

Unit # : E90 - S65

VIN # : WBSPM9C52 BE203212

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
VAC S65 Connecting Rod Bearings (Coated) & ARP Rod-bolt Set VAC-HPRBK-S65	1.00	799.95	799.95	Check over suspension for loose parts. Customer states he sometimes hears a rattle. Vehicle has many solid pieces that have replaced rubber in the suspension.	n/c
Oil Pan Gasket 11 13 7 841 085	1.00	44.83	44.83	Test drove vehicle and checked suspension components thoroughly - No problems found. In our experience this level of NVH is typical for the aftermarket suspension components installed.	
Oil Filter Kit (E90/92 M3) 11 42 7 837 997	1.00	33.13	33.13	Initialize TPM system. Warning is currently on.	n/c
10W-60 Full-Synthetic Oil LM2024 (5 Liter)	10.00	13.49	134.90	Intialized TPMS. Test drove, no warnings returned.	
Full Synthetic Power Steering Fluid LM20038	1.00	24.55	24.55	Replace Connecting-Rod bearings/bolt-set as preventative maintenance.	n/c
Engine Mount 11 81 2 283 798	2.00	135.00	270.00	Replaced connecting rod bearings and bolts per client request.	
O-ring 11 41 7 839 832	1.00	4.72	4.72	CONNECTING ROD BEARINGS - Remove & Replace - All	1,668.00
O-ring 11 41 7 839 833	1.00	3.55	3.55	Replaced connecting rod bearings and connecting rod bolts. During repairs, also replaced engine mounts.	
Water Temp. Sensor 13 62 1 433 076	1.00	57.43	57.43	Cleaned any visible debris from the oil pump pickup screens. NOTE: Due to the complex oiling system of this engine, we cannot guarantee all debris has been removed.	
Repair Kit Coolant Temp Sensor 12 51 7 847 971	1.00	23.18	23.18	Freight	35.00
BMW Engine Coolant CH EURO55 (BULK)	1.50	26.25	39.38	[COMBINATION] COOLANT TEMPERATURE SENSOR - Remove & Replace - Includes: Install wiring repair kit per SI B	111.20
Redline Water Wetter RLWW-12OZ	1.00	11.99	11.99	Customer states they get fault P3198. Checked faults, found BMW fault 2AF9 - Coolant temp plausibility: Coolant temp below oil temp. Checked for applicable SI B's, found bulletin for this fault. Inspected temp sensor per bulletin, confirmed evidence of fretting of the contacts. Replaced temp sensor and installed repair wiring per SI B. Cleared faults and monitored values - rechecks ok after repair.	
Brake Fluid DOT4 RBF 600 .5L 100949	2.00	24.59	49.18	Flush & fill cooling system.	78.83
Redline D4 ATF RL30505 (Bulk)	1.50	13.90	20.85	Completed coolant flush. Added Water Wetter. Filled and bled cooling system.	
Redline 75W-140 Gear Oil RL57914-QT	2.00	22.50	45.00	Flush & bleed brake system.	80.33
Shop Supplies			40.00	Completed brake fluid flush with high temp RBF 600	
				MANUAL TRANSMISSION FLUID - Drain & Fill	69.50
				Drained and filled transmission. Removed and cleaned manual transmission fluid screen.	
				DIFFERENTIAL FLUID - Drain & Fill	69.50
				Drained and filled rear differential.	
				Hazardous Waste Disposal	20.00



INVOICE

46720

Org. Est. # 117193

INVOICE

bmw + audi + mini
independent specialists

Date: 04/29/2021

2011 BMW - M3 - 4L, V8 (0CI) VIN(C)

Lic #: 631EB

Odometer In : 29958

Unit #: E90 - S65

VIN #: WBSPM9C52 BE203212

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate	3,852.59	Revisions	0.00	Current Estimate	3,852.59
---------------	----------	-----------	------	------------------	----------

Labor:	2,077.36
Parts:	1,602.64
Sublet:	35.00
HazMat:	20.00
SubTotal:	3,735.00
Tax:	117.59
Total:	3,852.59
Bal Due:	\$3,852.59

[Payments -]
Vehicle Received: 4/28/2021

Customer Number : 12284

Limited Warranty-Non-transferable-OriginalPurchaser Only - Warranty on parts and labor is 2 years or 24,000 miles whichever comes first unless otherwise noted on invoice. Warranties do NOT cover friction surfaces, including but not limited to: brake pads, brake discs, clutch pressure plates, clutch discs & flywheels. Warranty work must be performed at Orr Autosport, LLC and cannot exceed the original cost of repair.

Signature _____ Date _____



BMW OF MINNETONKA

VIN: WBSPM9C52BE203212
Work Order: R957605
Odometer: 28195
Customer Number: 5123
Date: 12.4.19 8:41



WBSPM9C52BE203212

BMW 2011 E90 M3 18" Wheel 4-Wheel Total Alignment

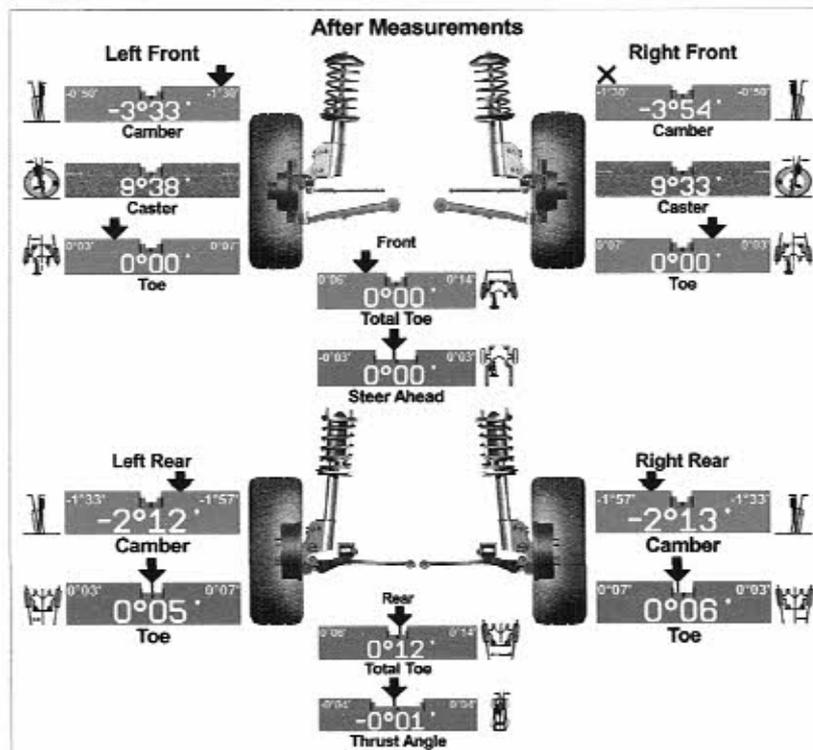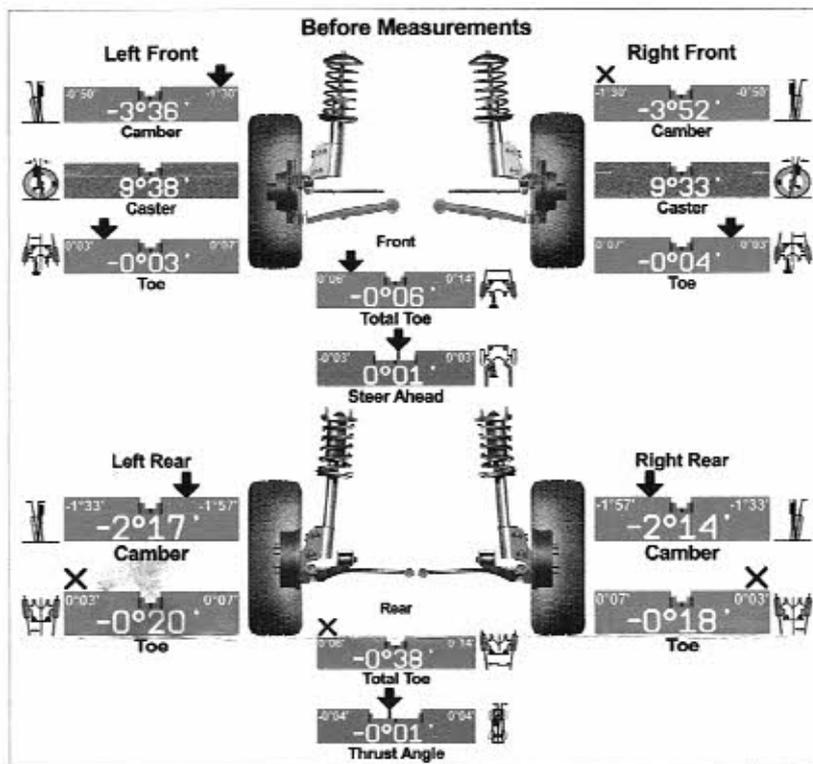

• One or more values are not within specification. Tire wear, handling and safety problems may result.

CUSTOMER #: B844

584492



BMW of Minnetonka

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
Service Direct: (952) 303-7501
www.bmwofminnetonka.com

INVOICE

DUPLICATE 1
PAGE 1

SERVICE ADVISOR: 10477 Joshua Hines

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a BMW M3 SEDAN with VIN WBSPM9C52BE203212, 29062/29065 miles, and a payment of 0.00 CASH on 25JUN19.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Details work order for 'A CHECK ENGINE LIGHT ON' with a total cost of 523.90. Includes parts list for thermostat, antifreeze, and O-ring.

29065 FAULTY THERMOSTAT
6.2 HOOK UP A BATTERY CHARGER AND CHECK FOR FAULTS. FOUND FAULT STORED FOR THERMOSTAT. CHECK OPERATION OF THE THERMOSTAT AND FOUND IT TO BE STUCK OPEN. REMOVE INTAKE AND REPLACE THE THERMOSTAT. FILL AND BLEED THE COOLING SYSTEM. CLEAR FAULTS. ROAD TEST-OK.
EMPLOYEE DISCOUNT APPLIED

EST: 0.00 03JUN19 15:33 SA: 10477
EMPLOYEE

0.16
7.28
0.53


Table with columns: DESCRIPTION, TOTALS. Includes warranty terms and a summary of charges: LABOR AMOUNT 523.90, PARTS AMOUNT 105.95, TOTAL CHARGES 629.85, SALES TAX 7.97, TOTAL 637.82.

VIN: **WBSPM9C52BE203212**
 Work Order: **R949134**
 Odometer: **264256**
 Customer Number: **2063**
 Date: **9.5.18 15:21**



WBSPM9C52BE203212

BMW 2011 E90 M3 19" Wheel 4-Wheel Total Alignment

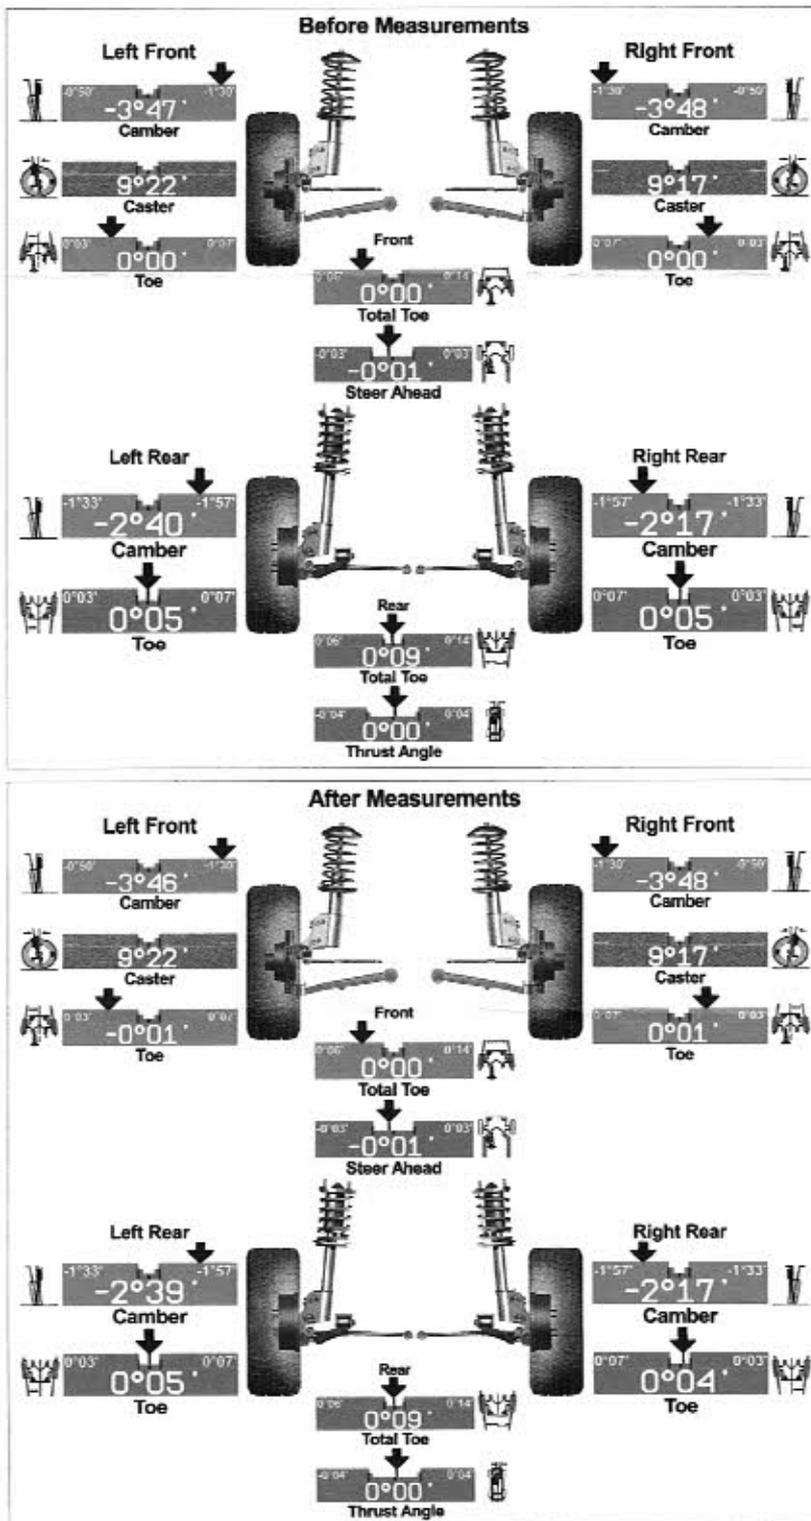

• One or more values are not within specification. Tire wear, handling and safety problems may result.

CUSTOMER #: B844

554648



BMW of Minnetonka

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
Service Direct: (952) 303-7501
www.bmwofminnetonka.com

INVOICE

PAGE 1

BUS: CELL: SERVICE ADVISOR: 10277 Timothy Storms

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG. Includes details for a BMW M3 SEDAN with VIN WBSPM9C52BE203212 and mileage 26534/26546.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL.

A MOUNT AND BALANCE 4 TIRES CLIENT SUPPLIED
CAUSE: Cust is having tires mounted somewhere else.
MB4 MOUNT AND BALANCE 4 TIRES CLIENT SUPPLIED
10247 CBLD 0.00 0.00
26546 Cust is having tires mounted somewhere else. Cust is having tires mounted somewhere else.

B FLUID LEAK FROM ENGINE AREA.
CAUSE: No leak present at this time
LEAK FLUID LEAK FROM ENGINE AREA.
10247 CB 0.00 0.00
26546 No leak present at this time Inspected vehicle for leaks. No leaks present at this time.

C SUSPENSION SYSTEM CONCERN NOISE I SUSPENSION
CAUSE: Front camber plate bolts has loosed
SUSPCON SUSPENSION SYSTEM CONCERN NOISE I
SUSPENSION
10247 CB 0.00 0.00
26546 Front camber plate bolts has loosed Confirmed the noise described by the cust. Found the RF camber plate nut to have loosened. Removed nut and applied medium strength thread locking compound to the nut and reinstalled. Test drove vehicle after repair. Noise is no longer present. Checked LF camber plate nut and found it starting to loosen. Removed nut and applied thread locking compound and reassembled. Test drove vehicle and found it to be operating normally. Recommend cust monitor the front camber plate nuts for loosening.

EST: 133.74 23MAY18 07:26 SA: 10277

Table with columns: DESCRIPTION, TOTALS. Includes rows for LABOR AMOUNT, PARTS AMOUNT, GAS, OIL, LUBE, SUBLET AMOUNT, MISC. CHARGES, TOTAL CHARGES, LESS INSURANCE, SALES TAX, and PLEASE PAY THIS AMOUNT.

CUSTOMER #: B844

552735



BMW of Minnetonka

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
Service Direct: (952) 303-7501
www.bmwofminnetonka.com

INVOICE

PAGE 1

BUS: CELL: SERVICE ADVISOR: 10277 Timothy Storms

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG. Includes details for a BMW M3 SEDAN with VIN WBSPM9C52BE203212, license 26423/26499, and tag T6734. Also includes delivery and payment dates.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Line A: PERFORM CBS OIL AND RESET ALL CBS DATA. 10247 CBLD. 26423 Performed oil service. NET 23.00, TOTAL 23.00.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Line B: MOUNT AND BALANCE 4 TIRES. MB4 MOUNT AND BALANCE 4 TIRES. 10247 CBLD. 26423 Mounted and balanced customer supplied wheels and tires. NET 119.95, TOTAL 119.95.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Line C: PERFORM COMPUTERIZED 4 WHEEL ALIGNMENT SPECIAL PRICE. S4ALIGN PERFORM COMPUTERIZED 4 WHEEL ALIGNMENT SPECIAL PRICE. 10247 CB. 89.95. 1 07-14-6-949-380 BODY NUT:889520. 0.64. 2 07-11-9-903-995 HEX BOLT:071000. 0.78. 26423 Performed performance alignment with additional camber and toe adjustment done with Race suspension parts.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Line D: INSTALL CLIENT SUPPLIES SUSPENSION PARTS. SUSPCON INSTALL CLIENT SUPPLIES SUSPENSION PARTS. 10247 CB. 1303.50. 6 51-16-1-881-149 EXPANDING RIVET:889520. 1.38. 10 51-71-1-958-025 PLASTIC NUT:889520. 4.20. 26423 16.5 Installed customer supplied coil over suspension kit. Front and rear sway bars. Front and rear sway bar end links. Customer supplied camber bolt conversion. Customer supplied rear adjustable toe arm. Installed customer supplied thrust rod bushings.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Line E: INSTALL CLIENT SUPPLIED PARTS BRAKE KIT. BRAK INSTALL CLIENT SUPPLIED PARTS BRAKE KIT. 10247 CBLD. 422.50. 26423 6.5 Installed after market 4 wheel brake kit with new matching brake soft lines. Removed old wheel studs and installed new

THE FACTORY WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS.

NO CLAIMS WITHOUT THIS INVOICE. NO RETURNS ON ELECTRICAL COMPONENTS. NO RETURNS ON SPECIAL ORDERS. NO RETURNS AFTER 10 DAYS. 20% HANDLING CHARGE ON ALL RETURNS. ALL PARTS ARE NEW ORIGINAL EQUIPMENT UNLESS OTHERWISE SPECIFIED. I hereby authorize the repair work herein set forth to be done along with the necessary material, and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Table with columns: DESCRIPTION, TOTALS. Rows include: LABOR AMOUNT, PARTS AMOUNT, GAS, OIL, LUBE, SUBLET AMOUNT, MISC. CHARGES, TOTAL CHARGES, LESS INSURANCE, SALES TAX, PLEASE PAY THIS AMOUNT.



CUSTOMER COPY

CUSTOMER #: B844

552735



BMW of Minnetonka

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
Service Direct: (952) 303-7501
www.bmwofminnetonka.com

INVOICE

PAGE 2

BUS: CELL: SERVICE ADVISOR: 10277 Timothy Storms

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes vehicle details like BLACK, 11, BMW M3 SEDAN, WBSPM9C52BE203212, 26423/26499, T6734.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes entry for wheel studs.

F SUBFRAME/DIFF BUSHINGS BEING INSTALLED
SUSPCON SUBFRAME/DIFF BUSHINGS BEING INSTALLED
10247 CB 1264.00 1264.00
4 34-35-6-767-984 CABLE CLIP:889520 1.80
26423 16 Removed the differential and the rear sub frame. Pressed in solid diff bushings and solid sub frame bushings.

G SHIFTER BEING INSTALLED
ITRIMCON SHIFTER BEING INSTALLED
10247 CB 316.00 316.00
1 23-12-8-677-736 SHAFT SEAL:238520 15.52
26423 Installed customer supplied shifter, replaced the leaking shift shaft seal while I was in there.

H PERFORM COMPLIMENTARY VEHICLE INSPECTION
CVI PERFORM COMPLIMENTARY VEHICLE INSPECTION
10247 CB 0.00 0.00
26423 Completed inspection

I COMPLIMENTARY WASH OF YOUR VEHICLE
WASH COMPLIMENTARY WASH OF YOUR VEHICLE
10247 CDB 0.00 0.00
26499 Did not wash vehicle

J RECALL SIB 64 07 17 BLOWER MOROT IF PARTS AVAILABLE
CAUSE: Sib
0065250 Checking and installing short repair cable
10247 WRB (N/C)
1 61-11-8-716-086 REPLACEMENT CABLE HEATER
CON:889700 (N/C)
FC: 0061660400

Table with columns: THE FACTORY WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS. NO CLAIMS WITHOUT THIS INVOICE. NO RETURNS ON ELECTRICAL COMPONENTS. NO RETURNS ON SPECIAL ORDERS. NO RETURNS AFTER 10 DAYS. 20% HANDLING CHARGE ON ALL RETURNS. ALL PARTS ARE NEW ORIGINAL EQUIPMENT UNLESS OTHERWISE SPECIFIED. I hereby authorize the repair work herein set forth to be done along with the necessary material, and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. X

CUSTOMER #: B844

552735



BMW of Minnetonka

15802 Wayzata Blvd. Minnetonka, Minnesota 55391 Phone: (952) 303-7500 Service Direct: (952) 303-7501 www.bmwofminnetonka.com

INVOICE

PAGE 3

BUS: CELL: SERVICE ADVISOR: 10277 Timothy Storms

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes data for a BMW M3 SEDAN with VIN WBSPM9C52BE203212.

Table with columns: R.O. OPENED, READY, OPTIONS, ENG: 4.0 LITER, TRN: MANUAL, LIST, NET, TOTAL. Includes time and date data: 10:03 30APR18 15:26 15MAY18.

PART#: COUNT: CLAIM TYPE: AUTH CODE:

26423 Sib Inspected blower motor wiring and installed short repair harness.

K** LINES ADDED FOR NEEDS

CAUSE: MISC CONCERN

MISC CONCERN 10247 CB

237.00 237.00

26499 3.0 Installed new start button and new M button. Installed aftermarket splitter.

L** BRAKE FLUID FLUSH: CONDITION BASED SERVICE

CAUSE: CBS BRAKE FLUID REPLACEMENT/FLUSH

BR05 System, Brakes - Flush 10247 CBLD

65.00 65.00

26423 Bled brakes with customer supplied brake fluid.

EST: 259.68 30APR18 10:03 SA: 10277

CMG EMPLOYEE

0.04

1.67

0.12

THE FACTORY WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS.

NO CLAIMS WITHOUT THIS INVOICE. NO RETURNS ON ELECTRICAL COMPONENTS. NO RETURNS ON SPECIAL ORDERS. NO RETURNS AFTER 10 DAYS. 20% HANDLING CHARGE ON ALL RETURNS.

ALL PARTS ARE NEW ORIGINAL EQUIPMENT UNLESS OTHERWISE SPECIFIED

I hereby authorize the repair work herein set forth to be done along with the necessary material, and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

Table with columns: DESCRIPTION, TOTALS. Includes rows for LABOR AMOUNT (3840.90), PARTS AMOUNT (24.32), GAS, OIL, LUBE (0.00), SUBLET AMOUNT (0.00), MISC. CHARGES (0.00), TOTAL CHARGES (3865.22), LESS INSURANCE (0.00), SALES TAX (1.83), PLEASE PAY THIS AMOUNT (3867.05).



CUSTOMER COPY



METRIC AUTO WORKS INC.
 670 COMMERCE DRIVE SUITE 150
 WOODBURY, MN. 55125
 Phone: 651-228-9840 Fax: 651-287-0877
 metricautoworks.com

INVOICE
35897
 Org. Est. # 069880

INVOICE

Date: 07/21/2017

2011 BMW - M3 - 4L, V8 (0Ci) VIN(C)
 Lic # :631EB - MN
 Odometer In : 0
 Odometer Out : 25503

VIN # :WBSPM9C52 BE203212

Part Description	Qty	Sale	Ext	Labor Description	Ext
Motor Oil RaceTech 10W-60 - 1 Ltr	9.00	9.62	86.58	OIL SERVICE WITH INSPECTION - SYNTHETIC	27.00
Oil Filter Kit - w/ O-Ring	1.00	27.43	27.43	REPLACE SYNTHETIC ENGINE OIL AND FILTER - REPLACE	
BMW OIL SERVICE DISCOUNT	1.00	-26.03	-26.03	DRAIN PLUG GASKET - INSPECT AIR FILTER - INSPECT AND	
Gear Oil MTL 75W-80 GL-4 -1 Qrt	3.00	22.16	66.48	TOP-UP FLUIDS - INSPECT BELTS AND HOSES - INSPECT AND	
Gear Oil 75W-140 GL-5 / 1 Quart	2.00	24.03	48.06	INFLATE TIRES - LUBRICATE CHASSIS	
				CHANGE TRANSMISSION FLUID AND FLUSH THE COOLER	118.00
				CHANGE REAR DIFF FLUID	59.00

[Payments -]

Labor:	204.00
Parts:	202.52
Sub:	406.52
Tax:	16.28
Total:	\$422.80
Bal Due:	\$422.80

Parts and Labor Warranty 2 Years - 24k miles on most repairs - Must be performed at Metric Auto Works for coverage
 Any vehicles left in the lot for more that 5 days will incur a 20.00 per day storage charge unless prior arrangements have been made.

Vehicle Received: 7/21/2017



METRIC AUTO WORKS INC.
 670 COMMERCE DRIVE SUITE 150
 WOODBURY, MN. 55125
 Phone: 651-228-9840 Fax: 651-287-0877
 metricautoworks.com

INVOICE

35813

Org. Est. # 069791

INVOICE

Date: 07/07/2017

2011 BMW - M3 - 4L, V8 (0Ci) VIN(C)

Lic # :631EB - MN

Odometer In : 0

VIN # :WBSPM9C52 BE203212

Part Description	Qty	Sale	Ext	Labor Description	Ext
				MOUNT AND BALANCE 4 TIRES (<50 SERIES)	168.80

[Payments -]

Labor:	168.80
Parts:	0.00
Sub:	168.80
Tax:	0.00
Total:	\$168.80
Bal Due:	\$168.80

Parts and Labor Warranty 2 Years - 24k miles on most repairs - Must be performed at Metric Auto Works for coverage
 Any vehicles left in the lot for more that 5 days will incur a 20.00 per day storage charge unless prior arrangements have been made.

Vehicle Received: 7/7/2017



Imola Motorsports, Inc.
 2980 Empire Lane
 Plymouth, MN 55447
 Phone: 763-205-2561 Fax: 763-208-6930

06/23/2017

**Invoice #
34937**

PAID

2011 BMW M3

Odometer In: 25153
 License:

Odometer Out: 25156
 VIN: WBSPM9C52BE203212

Eng: 4L, V8 (0CI) VIN(C)

Vehicle Time In: 6/23/2017 8:23:42AM

Description Of Services

Install Active Autowerke Software with Cat Delete

Active tune has been flashed onto vehicle.

Part Number	Description	Quantity	Sale	Extended
123456789	E9X M3 PERFORMANCE SOFTWARE - 91 OCTANE COLD START / HIGH IDLE DELETE	1.00	\$749.99	\$749.99

Labor: \$90.00 Parts: \$749.99 Sublet:\$0.00 Subtotal: \$839.99

Saved Estimates

06/20/2017 E9X M3 PERFORMANCE SOFTWARE

Service Advisor: Miller, TJ

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

All Imola Motorsports factory replacement parts and labor carry a 24 month/24,000 mile warranty. Consumable part items such as brakes, tires and clutches etc are evaluated on a case by case basis. Imola Motorsports parts warranty does NOT apply on customer supplied parts.

I acknowledge that some aftermarket work performed by Imola Motorsports, may further enhance the performance of my vehicle. I hereby release Imola Motorsports from any actions, claims, loss, liability, damage or costs, occurring in connection with operating my vehicle.

Labor Total:	\$90.00
Parts Total:	\$749.99
Sublet Total:	\$0.00
Shop Sup.:	\$0.00
HazMat:	\$0.00

Sub Total:	\$839.99
Tax Total:	\$54.56
Grand Total:	\$894.55
Balance Due:	\$0.00



SIGNATURE..... Date.....

Payment(s)
 6/23/2017 6:45:33PM \$894.55 Visa





METRIC AUTO WORKS INC.
 670 COMMERCE DRIVE SUITE 150
 WOODBURY, MN. 55125
 Phone: 651-228-9840 Fax: 651-287-0877
 metricautoworks.com

INVOICE

35436

Org. Est. # 069372

INVOICE

Date: 05/16/2017

2011 BMW - M3 - 4L, V8 (0CI) VIN(C)

Lic # :631EB - MN

Odometer In : 0
 Odometer Out : 24803

VIN # :WBSPM9C52 BE203212

Part Description	Qty	Sale	Ext	Labor Description	Ext
				ALIGNMENT-LOWER THE REAR SUSPENSION	177.00

[Payments -]

Parts and Labor Warranty 2 Years - 24k miles on most repairs - Must be performed at Metric Auto Works for coverage
 Any vehicles left in the lot for more that 5 days will incur a 20.00 per day storage charge unless prior arrangements have been made.

Labor:	177.00
Parts:	0.00
Sub:	177.00
Tax:	0.00
Total:	\$177.00
Bal Due:	\$177.00

Vehicle Received: 5/16/2017



METRIC AUTO WORKS INC.
 670 COMMERCE DRIVE SUITE 150
 WOODBURY, MN. 55125
 Phone: 651-228-9840 Fax: 651-287-0877
 metricautoworks.com

INVOICE

35166

INVOICE

Date: 04/04/2017

2011 BMW - M3 - 4L, V8 (0CI) VIN(C)

Lic # : - MN

Odometer In : 0

Odometer Out : 24247

VIN# :

Part Description	Qty	Sale	Ext	Labor Description	Ext
Motor Oil RaceTech 10W-60 - 1 Ltr	9.00	9.62	86.58	OIL SERVICE WITH INSPECTION - SYNTHETIC	27.00
Oil Filter Kit - w/ O-Ring	1.00	27.43	27.43	REPLACE SYNTHETIC ENGINE OIL AND FILTER - REPLACE	
BMW OIL SERVICE DISCOUNT	1.00	-26.03	-26.03	DRAIN PLUG GASKET - INSPECT AIR FILTER - INSPECT AND	
BRAKE FLUID - DOT4 LOW VISCOSITY	1.00	21.73	21.73	TOP-UP FLUIDS - INSPECT BELTS AND HOSES - INSPECT AND	
				INFLATE TIRES - LUBRICATE CHASSIS	
				REPLACE THE BRAKE FLUID	94.40

[Payments -]

Labor:	121.40
Parts:	109.71
Sub:	231.11
Tax:	9.67
Total:	\$240.78
Bal Due:	\$240.78

Parts and Labor Warranty 2 Years - 24k miles on most repairs - Must be performed at Metric Auto Works for coverage
 Any vehicles left in the lot for more that 5 days will incur a 20.00 per day storage charge unless prior arrangements have been made.

Vehicle Received: 4/4/2017



CAROUSEL
MOTOR GROUP

BMW OF MINNETONKA

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
www.bmwofminnetonka.com



Staged

CUSTOMER NO. 844	ADVISOR BRIANNA FALK	1228	TAG NO. 8720	INVOICE DATE 05/13/16	INVOICE NO. BMCS484133
	LABOR RATE	LICENSL NO.	MIL FAGE 20,247	COLOR	STOCK NO.
	YEAR / MAKE / MODEL 11/BMW/M3/			DELIVERY DATE	DELIVERY MILES
	VEHICLE ID. NO. W B S P M 9 C 5 2 B E 2 0 3 2 1 2			SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.		R.O. DATE 05/13/16	
COMMENTS					MO: 20249

LABOR & PARTS		TECH(S):		0.00
J# 1	65BMZ02	LOANER CAR	1228	0.00
CUSTOMER REQUESTED A LOAN SUPPLIED LOANER CAR.				
PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
				JOB # 1 TOTAL PARTS
				JOB # 1 TOTAL LABOR & PARTS
J# 2	01BMZ00	FREE INSPECTION	1424	0.00
PERFORM A FREE INSPECTION (\$65.25 VALUE) PERFORMED FREE INSPECTION				
PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
				JOB # 2 TOTAL PARTS
				JOB # 2 TOTAL LABOR & PARTS
J# 3	00BMZ05	SYNTH-LOF	1424	23.00
CUSTOMER REQUESTS SYNTH OIL & FILTER CHANGE. LOW MILEAGE SERVICE CHANGED ENGINE OIL AND FILTER (USED SYNTHETIC OIL)				
PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 3	1	11-42-7-837-997	SET OIL-FILTER ELEM	14.64
JOB # 3	9	83-21-2-365-944	BMW M TWINPOWER TUR	9.94
				JOB # 3 TOTAL PARTS
				JOB # 3 TOTAL LABOR & PARTS
J# 4	01BMZ	RECOMMENDED MAINT	1228 1424	0.00
ADVISE ON COLOR OF BRAKE FLUID - UNSURE WHEN LAST FLUSHED CUSTOMER DECLINED				
PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
				JOB # 4 TOTAL PARTS
				JOB # 4 TOTAL LABOR & PARTS
J# 5	51BMZ	BODY ELECTRICAL	1424	99.95
PROVIDE ESTIMATE FOR REPLACING HALO BULBS WITH OEM BULBS. CURRENTLY HAS LED BULBS. AFTERMARKET LED SYSTEM REMOVED WIRING AND REPLACED LED BULBS WITH OEM.				
PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 5	1	07-11-9-906-503	BULB	18.85
JOB # 5	1	07-11-9-906-503	BULB	18.85
				JOB # 5 TOTAL PARTS
				JOB # 5 TOTAL LABOR & PARTS
MISC	CODE	DESCRIPTION	CONTROL NO.	
JOB # A	SS	SUPPLIES/ENVIRONMENTAL FEES		12.54

I hereby authorize the repair work herein set forth to be done along with the necessary material, and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

X

THE FACTORY WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS.

NO CLAIMS WITHOUT THIS INVOICE

NO RETURNS ON ELECTRICAL COMPONENTS

NO RETURNS ON SPECIAL ORDERS

NO RETURNS AFTER 14 DAYS

20% HANDLING CHARGE ON ALL RETURNS

ALL PARTS NEW ORIGINAL EQUIPMENT UNLESS OTHERWISE SPECIFIED

The Reynolds and Reynolds Company, EPHRAIME, COB0436 C, (07/15)



CAROUSEL
MOTOR GROUP

BMW OF MINNETONKA

15802 Wayzata Blvd.
Minnetonka, Minnesota 55391
Phone: (952) 303-7500
www.bmwofminnetonka.com



CUSTOMER NO 844	ADVISOR BRIANNA FALK	1228	TAG NO 8720	INVOICE DATE 05/13/16	INVOICE NO BMCS484133
LABOR RATE		LICENSE NO.	MILEAGE 20,247	COLOR /	STUCK NO
YEAR / MAKE / MODEL 11/BMW/M3/		DELIVERY DATE		DELIVERY MILES	
VEHICLE ID NO. WBSPM9C52BE203212		SELLING DEALER NO.		PRODUCTION DATE	
F.T.E. NO.		P.O. NO.		R.O. DATE 05/13/16	
COMMENTS					MO: 20249

MISC	CODE	DESCRIPTION	CONTROL NO	
JOB # 3	CPNS	COUPON OR DISCOUNT - MUST ATTATCH		-15.00
TOTAL - MISC				-2.46
ESTIMATE				
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING ORIGINAL ESTIMATE OF \$0.00 (+TAX)				
TOTALS				
*****				TOTAL LABOR....
* [] CASH [] CHECK CK NO. [] *				122.95
* [] VISA [] MASTERCARD [] DISCOVER *				TOTAL PARTS....
* [] AMER XPRESS [] OTHER [] CHARGE *				141.80
*****				TOTAL SUBLET....
				0.00
				TOTAL G.O.G....
				0.00
				TOTAL MISC CHG.
				12.54
				TOTAL MISC DISC
				-15.00
				TOTAL TAX.....
				10.32
				TOTAL INVOICE \$ 272.61

I hereby authorize the repair work herein set forth to be done along with the necessary material, and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

THANK YOU FOR YOUR BUSINESS!!

CUSTOMER SIGNATURE

X _____

THE FACTORY WARRANTY CONSTITUTES ALL OF THE WARRANTIES WITH RESPECT TO THE SALE OF THIS ITEM/ITEMS. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND THE SELLER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THIS ITEM/ITEMS.

NO CLAIMS WITHOUT THIS INVOICE

NO RETURNS ON ELECTRICAL COMPONENTS

NO RETURNS ON SPECIAL ORDERS

NO RETURNS AFTER 14 DAYS

20% HANDLING CHARGE ON ALL RETURNS

ALL PARTS NEW ORIGINAL EQUIPMENT UNLESS OTHERWISE SPECIFIED

The Barcode and Barcode Company ERM/ITM CC30436 Q (07/15)



P.O. Box 619063
 Dallas, TX 75261-9063
 DO NOT MAIL REPAIR ORDER TO THIS ADDRESS



3-777-01138-0026706-006-1-000-000-000-000



October 2018

This **"Important Limited Warranty Information"** applies to the BMW vehicle with the Vehicle Identification Number (VIN) of **WBSPM9C52BE203212**.

Dear BMW Owner/Lessee:

BMW is committed to delivering the ultimate in product satisfaction to our customers. Towards that end, BMW is extending the limited warranty for the:

- **Footwell Module (FRM)**

On the above-referenced vehicle to:

- **10 years/156,000 miles as determined by your vehicle's original in-service date.**

This "component-specific" limited warranty extensions apply to defects in materials or workmanship. This coverage is subject to the same vehicle eligibility requirements, limitations, and exclusions that apply to the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

This is notice of a "limited warranty extension." This is not a notice of a Recall or Service Action.

If repairs to these components are required, please contact your nearest authorized BMW center in the United States or Puerto Rico to schedule an appointment. Your authorized BMW center will determine the vehicle's eligibility and review the scope of repairs that are covered by this component-specific limited warranty extension(s).

After vehicle inspection and diagnosis, eligible repair work will be performed by the authorized BMW center in the United States (including Puerto Rico) free of charge.

Repairs performed on ineligible vehicles, eligible vehicles operated and repaired outside the United States and Puerto Rico and/or the diagnosis and repair of other unrelated issues are not covered by this limited warranty extension. This exclusion applies to repairs, including consequential, that were performed using non-genuine BMW parts and/or used passenger car or light truck parts.

The integrity of our products is essential to BMW's success and our customers' trust. We are determined to exceed your expectations and hope this warranty extension further enhances your ownership experience.

Sincerely,

BMW of North America, LLC

Company
 BMW of North America, LLC
 BMW Group Company

Mailing Address
 PO Box 1227
 Westwood, NJ
 07675-1227

Telephone
 (800) 831-1117

E-mail
 Customerrelations@
 bmwusa.com

Website
 bmwusa.com

777-3000-0714

Previous Customer-pay Repairs – Limited Warranty Extension Reimbursement

BMW of North America, LLC



October 2018

VIN WBSPM9C52BE203212

Under these extended limited warranties, BMW of North America, LLC ("BMW NA") will provide reimbursement for "qualifying customer-pay repairs" that were performed on an eligible vehicle **prior** to the release of these component-specific limited warranty extensions.

Customer-pay repairs are subject to the applicable vehicle and coverage eligibility requirements, exclusions and limitations that apply to the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Repairs that do not Qualify for Reimbursement

Repairs performed on ineligible vehicles, eligible vehicles operated and repaired outside the United States and Puerto Rico and/or the diagnosis and repair of other unrelated issues. This exclusion applies to repairs, including consequential, that were performed using non-genuine BMW parts and/or used passenger car or light truck parts.

Requesting Reimbursement for a Previous Repair that Qualifies

If you previously had a "qualifying customer-pay repair" performed either by an authorized BMW center or independent repair shop located in the United States (including Puerto Rico), please submit your reimbursement request "online" at www.BMW-RP.com under the following reference:

Covered Component Code

B-ELWR 2018 Footwell Module (FRM) 10Y156

To initiate the online process, you will be asked to attach PDF files of the required documentation as outlined in the reimbursement checklist on the next page.

Alternative Method to Request Reimbursement

Alternatively, you may mail or fax your request and documentation to:

BMW Customer Reimbursement Center
 Attention: B-ELWR 2018 Footwell Module (FRM) 10Y156
 P.O. Box 54067
 Hurst, Texas 76054
 Fax number: 877-434-2992

Please allow 4-6 weeks for processing your request.

Should you have any questions concerning this reimbursement process, please call 1-844-857-0341.

For all other questions, please contact BMW's Customer Relations and Services via email at Customerrelations@bmwusa.com or via telephone at 1-800-831-1117.

Please have your 17-character Vehicle Identification Number (VIN) available and include the VIN with all communications.

Footwell Module (FRM) : Limited Warranty Extension to 10 Years/156,000 Miles



Previous Customer-pay Repair Reimbursement – Documentation Checklist

BMW of North America, LLC

Reimbursement is available to the BMW Owner/Lessee who incurred the expense.

When submitting a reimbursement for a previous repair, please provide **legible copies** of the following documentation and include your VIN, name, address and your preferred contact telephone number(s):

Repair Order (RO) or Invoice

This document should include the following information:

- Customer name and address
- Vehicle Identification Number ("VIN")
- The date of repair
- The mileage when the repair was performed
- Itemized breakdown of the labor charges for all repairs* including diagnosis
- Itemized breakdown of the parts, including any miscellaneous items, billed for all repairs*

*For repair orders containing multiple repair line items, only the specific line item expenses that relate to the components that are covered by this extended limited warranty will be considered for reimbursement.

Proof of Payment

Please provide a copy of at least **one** of the following items as valid proof of payment:

- Repair order (RO)/invoice stamped and dated as "PAID"
- Copy of a cancelled check
- Copy of a signed credit/debit card receipt
- Copy of a credit/debit card statement

Determining if an eligible vehicle's repair qualifies for reimbursement:

Please use the following questions to review your repair order documentation prior to submitting a reimbursement request:

1. Why was the vehicle brought into the repair facility?
2. What was the repair facility's diagnosis?
3. What did the repair facility do to correct the concern and does it qualify?